

1 Release 10.17

1.1 General

This is the twelfth release with a fix for customer Sensus/Xylem. GWF H200. Integra / Ambill Soniq.

New features:

Improvements:

The Sensus/Xylem ECCUS could not be correctly decrypted. It has an ELL (CI-field 0x8C) that does not have the correct Access Number, the Access Number needs to be taken from the secondary CI-field (0x7A).

The GWF H200 and Ambill Soniq both have an ELL (CI-field 0x8C) that was not correctly decoded.

Bugs handled:

1.2 SVN/JIRA – Tag

- Revision 42737.

1.3 Known bugs / issues

- None